

LID 7165 (Loctite® 2700™ Reformulation)

October 2019

PRODUCT DESCRIPTION

Technology	Acrylic
Chemical Type	Dimethacrylate ester
Appearance (uncured)	Green liquid ^{LMS}
Fluorescence	Positive under UV light ^{LMS}
Components	One component-requires no mixing
Viscosity	Low
Cure	Anaerobic
Secondary Cure	Activator
Application	Threadlocking
Strength	High

LID 7165 (LOCTITE® 2700™) is designed for the permanent locking and sealing of threaded fasteners. The product cures when confined in the absence of air between close fitting metal surfaces and prevents loosening and leakage from shock and vibration. LID 7165 (LOCTITE® 2700™) is developed for applications where disassembly is not required.

TYPICAL PROPERTIES OF UNCURED MATERIAL

Specific Gravity @ 25 °C 1.1

Flash Point - See SDS

Viscosity, Cone & Plate, 25 °C, mPa·s (cP):


Shear rate 129 s⁻¹ 350 to 550^{LMS}

TYPICAL CURING PERFORMANCE

Cure Speeds Vs. Substrate


The rate of cure will depend on the substrate used. The graphs below shows the breakaway a strength developed with time on M10 steel nuts and bolts compared to different materials and tested according to ISO 10964.

Breakaway strength:

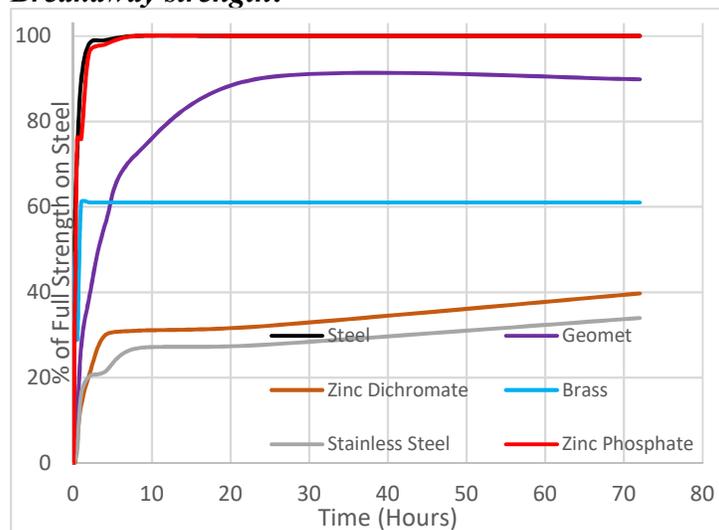

Cure Speed Vs. Bond Gap

Cure Speed vs. Bond Gap The rate of cure will depend on the bondline gap. Gaps in threaded fasteners depends on thread type, quality and size. The following graph shows shear strength developed with time on steel pins and collars at different controlled gaps and tested according to ISO 10123.


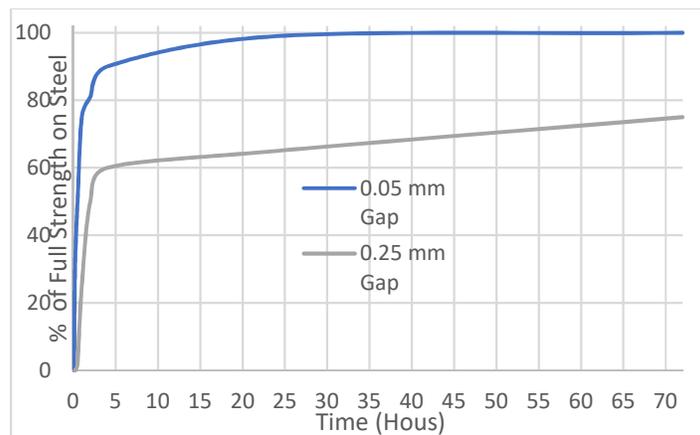


Cure Speed Vs. Temperature

Cure Speed vs. Temperature The rate of cure will depend on the temperature. The graph below shows

the breakaway strength developed with time at different temperatures on M10 stainless steel nuts and bolts, and tested according to ISO 10964

Stainless Steel:

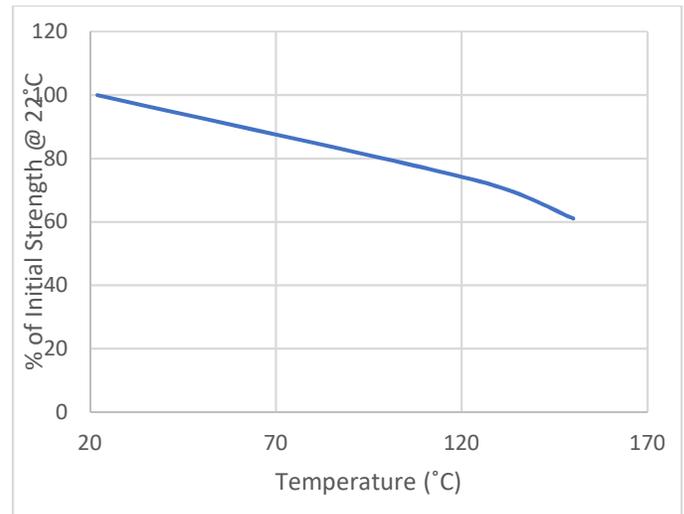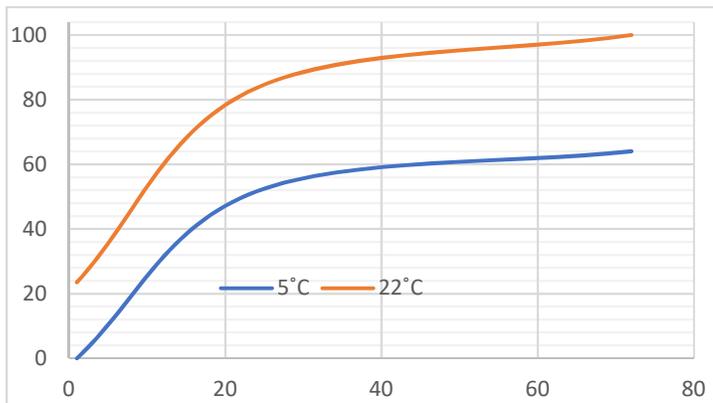

TYPICAL PERFORMANCE OF CURED MATERIAL

Adhesive Properties

Cured for 24 hours @ 22 °C
Breakaway Torque, ISO 10964:
M10 steel nuts and black oxide steel bolts
(unseated): 37 N.m (327 lb.in.)

Prevail Torque, ISO 10964:
M10 steel nuts and black oxide steel bolts
(unseated)
49.7 N.m (439 lb.in.)

Breakloose Torque, ISO 10964,
Pre-torqued to 5 N·m:
M10 steel nuts and Black oxide steel bolts
(seated): 25 N.m (221 lb.in.)

Compressive Shear Strength, ISO 10123: Steel pins
and collars $N/mm^2 \geq 5$ ^{LMS} (psi) (≥ 725)

TYPICAL ENVIRONMENTAL RESISTANCE

Cured for 1 week @ 22 °C
Breakloose Torque, ISO 10964,
Pre-torqued to 5 N·m: M10 zinc phosphate steel
nuts and bolts

Hot Strength

Tested at temperature

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials.

For safe handling information on this product, consult the Safety Data Sheet (SDS).

Where aqueous washing systems are used to clean the surfaces before bonding, it is important to check for compatibility of the washing solution with the adhesive. In some cases, these aqueous washes can affect the cure and performance of the adhesive.

This product is not normally recommended for use on plastics (particularly thermoplastic materials where stress cracking of the plastic could result). Users are recommended to confirm compatibility of the product with such substrates.

Directions for use:

For Assembly

1. For best results, clean all surfaces (external and internal) with a LOCTITE® cleaning solvent and allow to dry.
2. If the material is an inactive metal or the cure speed is too slow, spray all threads with Activator 7471™ or 7649™ and allow to dry.
3. Shake the product thoroughly before use.
4. To prevent the product from clogging in the nozzle, do not allow the tip to touch metal surfaces during application.

5. For Thru Holes, apply several drops of the product onto the bolt at the nut engagement area.
6. For Blind Holes, apply several drops of the product down the internal threads to the bottom of the hole.
7. For Sealing Applications, apply a 360° bead of product to the leading threads of the male fitting, leaving the first thread free. For bigger threads and voids, adjust product amount accordingly.
8. Assemble and tighten as required.

For Disassembly

1. Remove with standard hand tools.
2. In rare instances where hand tools do not work because of excessive engagement length, apply localized heat to nut or bolt to approximately 250 °C. Disassemble while hot.

For Cleanup

1. Cured product can be removed with a combination of soaking in a Loctite solvent and mechanical abrasion such as a wire brush

Loctite Material Specification ^{LMS}

LMS dated August-18, 2019. Test reports for each batch are available for the indicated properties. LMS test reports include selected QC test parameters considered appropriate to specifications for customer use. Additionally, comprehensive controls are in place to assure product quality and consistency. Special customer specification requirements may be coordinated through Henkel Quality.

Storage

Store product in the unopened container in a dry location. Storage information may be indicated on the product container labeling. **Optimal Storage: 8 °C to 21 °C. Storage below 8 °C or greater than 28 °C can adversely affect product properties.** Material removed from containers may be contaminated during use. Do not return product to the original container. Henkel Corporation cannot assume responsibility for product which has been contaminated or stored under conditions other than those previously indicated. If additional information is required, please contact your local Technical Service Center or Customer Service Representative.